

### **Bore Clamp**

double-acting, pull-type, with and without centring function, clamping for bore diameter 16 to 46 mm, max. operating pressure from 50 up to 350 bar



**Advantages** 

- Clamping and supporting with one element
- Compact design
- High clamping force
- Repetitive accuracy of clamping force 0.005 mm
- 5 optimised clamping ranges
- Hardened support face
- Pneumatic seat check
- Easy exchange of segment clamping bushings
- Centring at the bottom of the body
- Compensating and non-centring variants are available
- Oil supply optionnally by pipe threads or drilled channels
- Standard FKM seals
- Vulcanised segment clamping bushing

# Pneumatic seat check

## **Application**

The bore clamp is particularly suitable for centring and clamping of workpieces with smooth machined bores ranging from 16 to 46 mm in diameter and a support surface square to the hole axis.

### Description

The bore clamp is a combination of a doubleacting pull-tpye cylinder equipped with a segement clamping bushing, which is pulled by a tie rod over a fixed cone. Thereby the segment clamping bushing expands radially to the bore diameter of the workpiece to be clamped.

By the simultaneous axial movement the workpiece is clamped onto the hardened support at the housing. The obtainable low-clamping force depends on the factor of friction within the bore and the operating pressure.

The sectioning of the complete clamping range from 16 to 46 mm in 5 sub-ranges (chart page 2) allows an optimum adaptation of tie rods, cone, workpiece support and operating pres-

For detailed information on possible lowclamping forces and maximum operating pressures see charts and diagrams on page 2.

### Important notes


Since the segment clamping bushings are operated by a tie rod, it is imperative to consider the max. operating pressure depending on the clamping range. A too high operating pressure will destroy the tie rod.

The maximum operating pressure for the segment clamping bushing is 80°C. Avoid clamping without workpiece, if possible.

Operating conditions and other data see data sheet A 0.100.


### **Connecting possibilities**

### Pipe thread

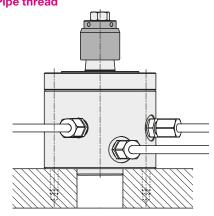

### **Drilled channels**

**Function** 

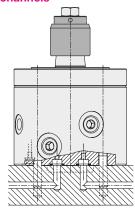

### **Centring function**

 Bore clamp with centring Part no.: 4317-X00



Fixed centring cone

# • Bore clamp with compensation

Part no.: 4317-X10

Centring cone in one axial direction ± 0.5 mm movable

# · Bore clamp without centring

Part no.: 4317-X20

Centring cone in all directions ± 0.5 mm movable

### **Applications**


• Centre and clamp in 1 bore hole




Centre and clamp in 2 bore holes



• Centre and clamp in more than 2 hore holes

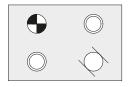

### Dimensions Technical data

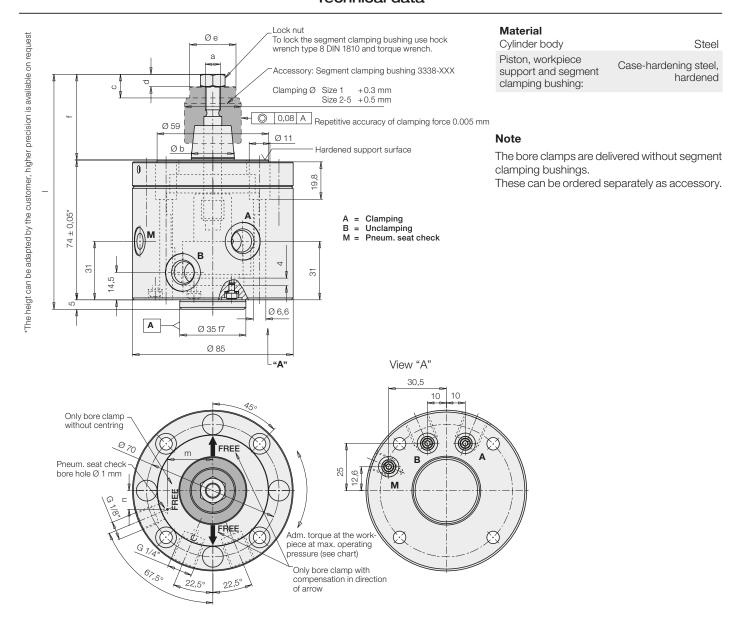


Size	(BG)	1	2	3	4	5
Clamping range Ø	[mm]	16-21.9	22-27.9	28-33.9	34-39.9	40-46
Max. low-clamping force	[kN]	0.6	1.3	3.1	5.5	7.9
Max. operating pressure	[bar]	50	75	150	250	350
Adm. torque	[Nm]	15	35	90	180	300
Max. oil volume Clamping/unclamping	[cm³]	2.45/4.02	2.45/4.02	2.45/4.02	2.45/4.02	2.45/4.02
a		M5	M6	M8	M10	M12
b	[mm]	12.8	16.8	22.8	28.8	34.8
С	[mm]	8	10	12.5	15	18
d	[mm]	4	5	6.5	8	10
е	[mm]	13.5	18.5	24.5	30.5	36.5
f	[mm]	39.5	43	45.5	54	57
1	[mm]	118.5	122	124.5	133	136
m	[mm]	15	15	24	24	24
n	[mm]	6	6	10	10	10
Seating torque Lock nut	[Nm]	6	10	25	49	85
Max. oil flow rate	[cm <sup>3</sup> /s]	20	20	20	20	20
Weight	[kg]	2.8	2.9	3	3.1	3.2
Part no.						
with centring		4317-100	4317-200	4317-300	4317-400	4317-500

4317-110 4317-210 4317-310 4317-410 4317-510

4317-120 4317-220 4317-320 4317-420 4317-520

### **Low-clamping force** Material: Steel, unhardened

Surface finish: Rmax. 3 µm

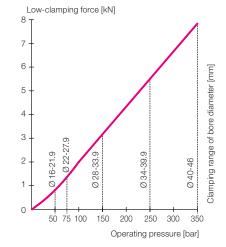

2

with compensation without centring

### Accessories Workpiece dimensions

### Accessory - segment clamping bushing

For each bore hole diameter within the clamping range the appropriate segment clamping bushing has to be selected:

# Part no. 3338-XXX (clamping Ø in 0.1 mm) Example of ordering:

Clamping Ø: 16.0 Part no. 3338-160 Clamping Ø: 34.8 Part no. 3338-348

# Adjustment of the segment clamping bushing

Unclamp bore clamp (extended). Unscrew lock nut of the bore clamp and screw on segment clamping bushing onto the threaded rod. Check the diameter of the segment clamping bushing by means of a vernier calliper.

The diameter of the segment clamping bushing should be adjusted to approx. 0.1 mm up to 0.2 mm less than the clamping diameter to be in the position to insert easily the workpiece to be clamped. Clamping without workpiece should be avoided due to the overexpansion of the vulcanisation.

Tightening torque for the lock nut see chart on page 2.


When tightening the lock nut to hold the segment clamping bushing without this to adjust.

# Accessory for connection through drilled channels

O-ring 8x1.5	Part no. 3000-343
Screw plug with collar ar	
G1/4	Part no. 3610-191
G1/8	Part no. 3610-158
Alternatively,	
sealing plug	
without collar with thread	d sealing ring
G1/4	Part no. 0361-987
G1/8	Part no. 0361-986

# Workpiece dimensions and workpiece tolerance

The workpiece to be clamped should always contact the hardened support surface and cover at least in the zone of the bore hole a minimum surface of the segment clamping bushing. This is only guaranteed, if the relevant dimensions meet the requirements shown in the drawing.

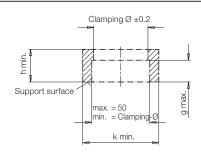

Size	(BG)	1	2	3	4	5
Clamping range Ø	[mm]	16-21.9	22-27.9	28-33.9	34-39.9	40-46
g max.	[mm]	12	12	12	15	15
h min.	[mm]	18	18	18	24	24
k min.	[mm]	35	35	55	55	55
Workpiece tolerance						
of selected clamping Ø	[mm] -	-0.1+0.3 -	-0.1+0.5 -	-0.1+0.5 -	-0.1+0.5 -	-0.1+0.5

Standard stepping 1 mm (intermediate stepping on request)

### Example:

Selected clamping diameter = 16 mm Workpiece tolerance = -0.1 up to +0.3 mm Workpiece diameter = 15.9 up to 16.3 mm